




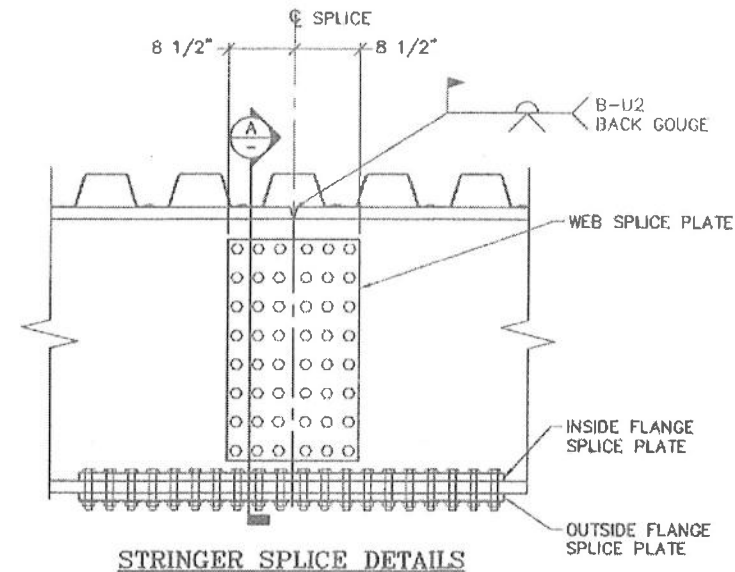

STRINGER SPICE DETAILS

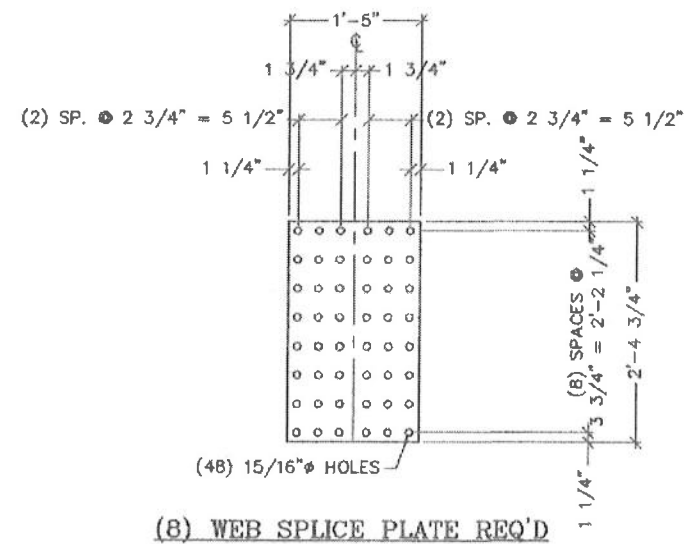


(8) WEB SPICE PLATE REQ'D

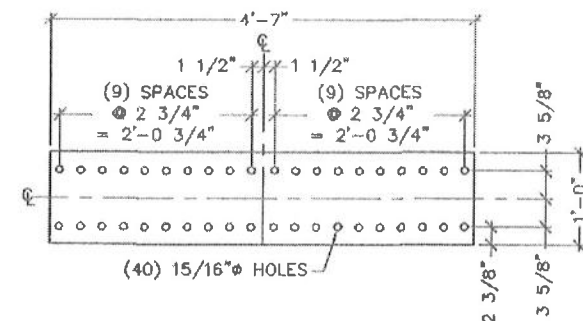


(4) OUTSIDE BTM FLANGE SPICE PLATE REQ'D

SHOP NOTE:
15/16"Ø HOLES IN STRINGER
FLANGE AND WEB

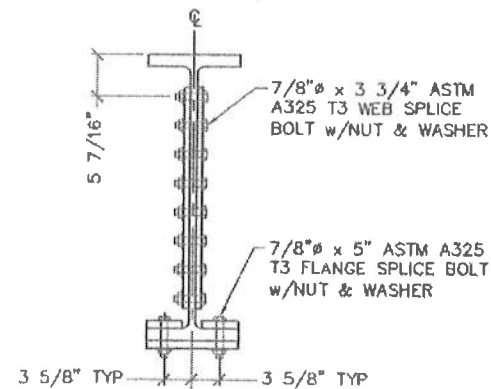

SECTION A

CONTRACTOR NOTE:
FIELD WELDING TO BE
PERFORMED BY A WELDER
CERTIFIED PER AWS D1.5
BRIDGE WELDING CODE.

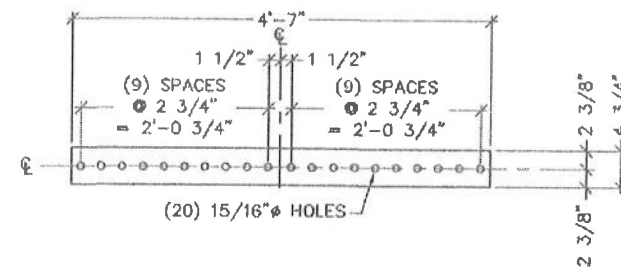

(8) INSIDE BTM FLANGE SPICE PLATE REQ'D

MEMBERS	QTY	THICKNESS	SIZE	HOLES	BOLTS w/NUT & WASHER	BOLT QTY
WEB SPICE PLATE	8	3/4"	1'-5" x 2'-4 3/4"	15/16"	7/8"Ø x 3 3/4" A325 T3	192
INSIDE BTM FLANGE SPICE PLATE	8	1"	4 3/4" x 4'-7"	15/16"	-	-
OUTSIDE BTM FLANGE SPICE PLATE	4	1"	1'-0" x 4'-7"	15/16"	7/8"Ø x 5" A325 T3	160

BR19-00664-M.dwg


REV	STATUS	BY	DATE
A	ISSUED FOR APPROVAL	RDH	10/21/2019

PROPRIETARY AND CONFIDENTIAL
THIS DRAWING IS THE SOLE PROPERTY OF BIG R MANUFACTURING, LLC.
AND CONTAINS PROPRIETARY INFORMATION FOR USE WITH THIS
PROJECT ONLY. ANY REPRODUCTION IN PART OR AS A WHOLE
WITHOUT WRITTEN PERMISSION IS STRICTLY PROHIBITED.



19060 County Road 66 • Greeley, Colorado 80631
(970) 356-9600 • Fax: (970) 356-9621 • www.bigrbridge.com

114'-0" x 12'-0"
TILSON FARM
MARION, VA
TILSON FARM

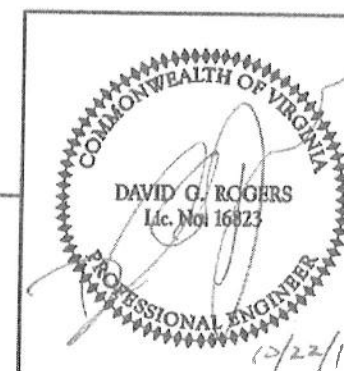

BR19-00664
DESIGN BY:
DTM
DRAWN BY:
RDH
CHECKED BY:
DTM
SHEET NO.

6